


System 3550 Rainscreen Attachment System Details with Mineral Wool Insulation


Revised 11/2020



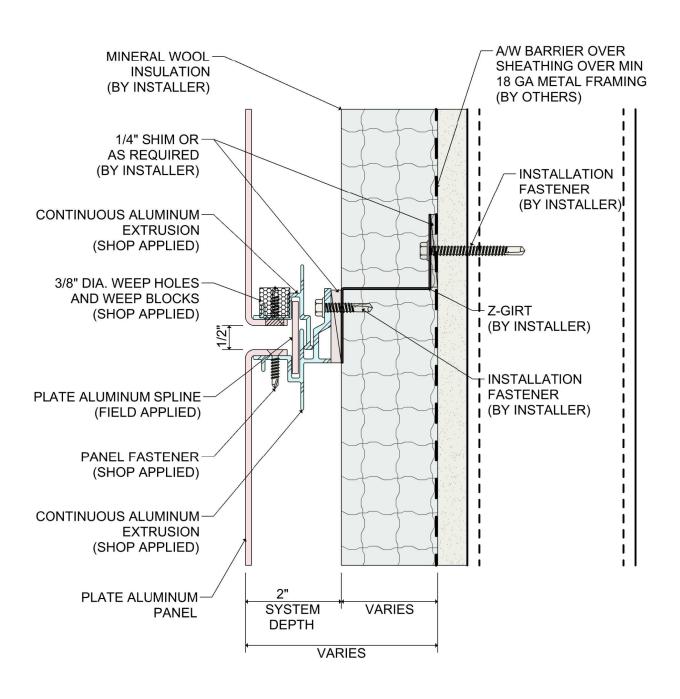

SYSTEM 3550




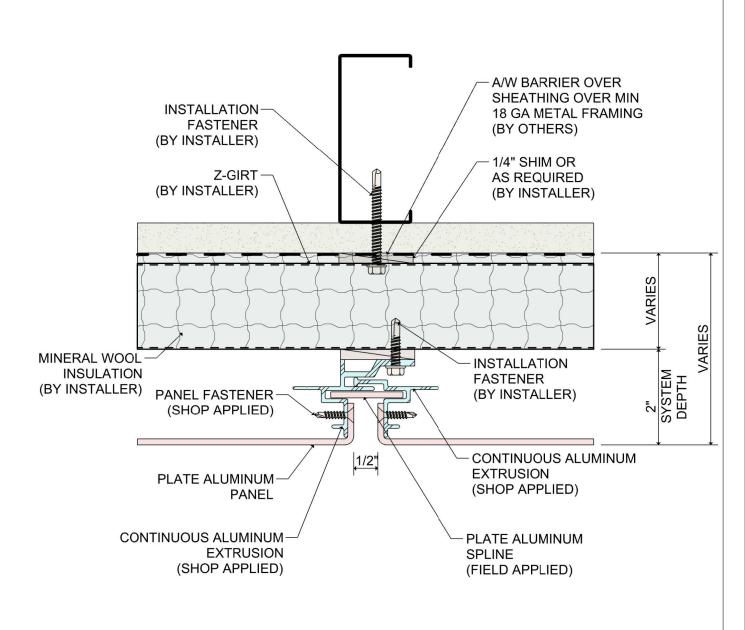

DETAIL: SYSTEM 3550 RAINSCREEN SYSTEM


VERTICAL JOINT



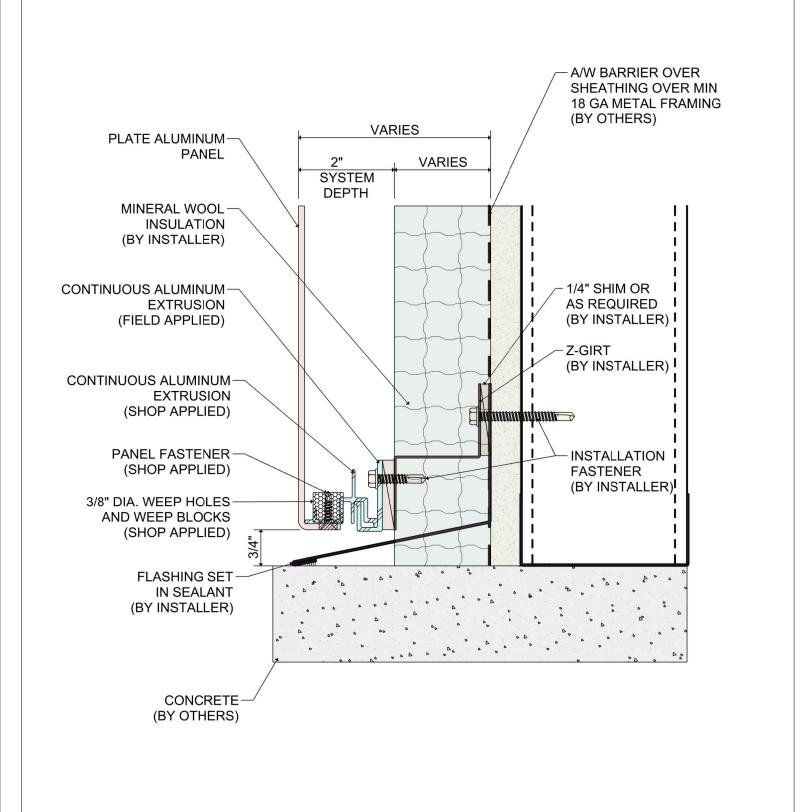

SYSTEM 3550 BASE DETAIL




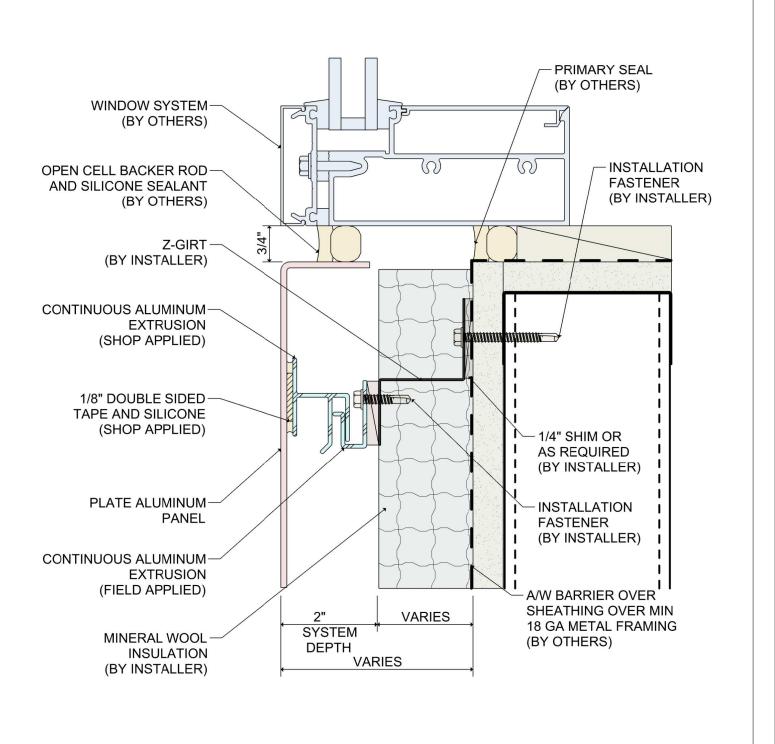

SYSTEM 3550 RAINSCREEN SYSTEM

WINDOW SILL DETAIL




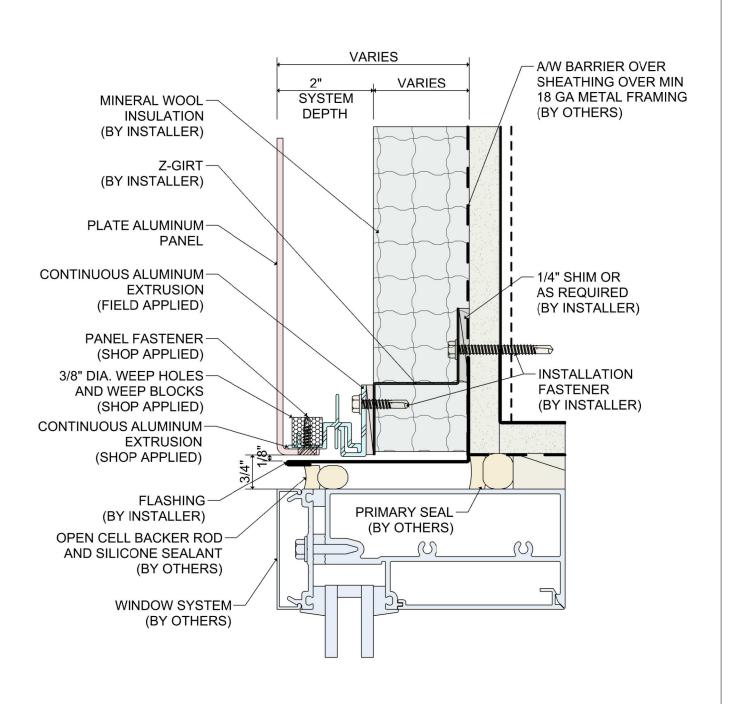

SYSTEM 3550 RAINSCREEN SYSTEM

WINDOW HEAD DETAIL




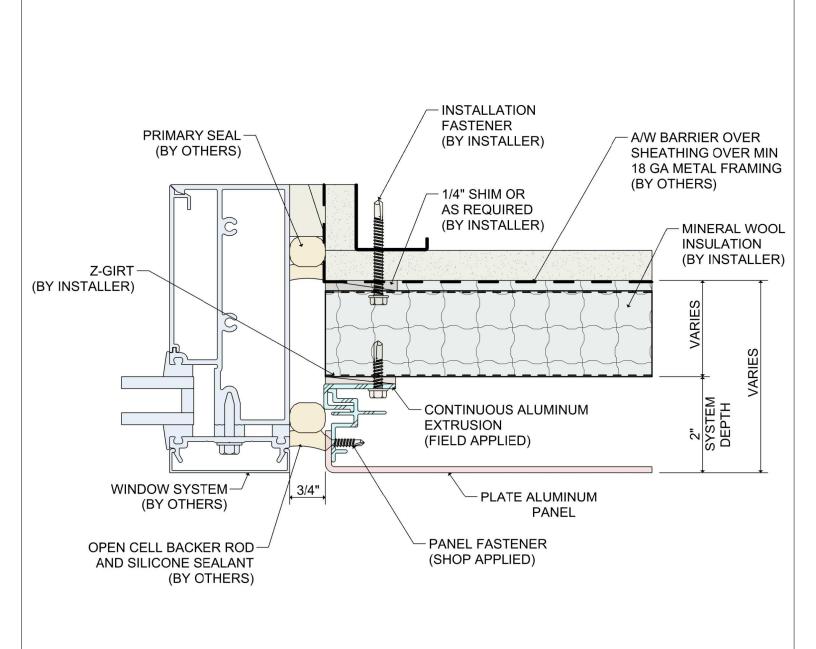

DETAIL:


WINDOW JAMB DETAIL



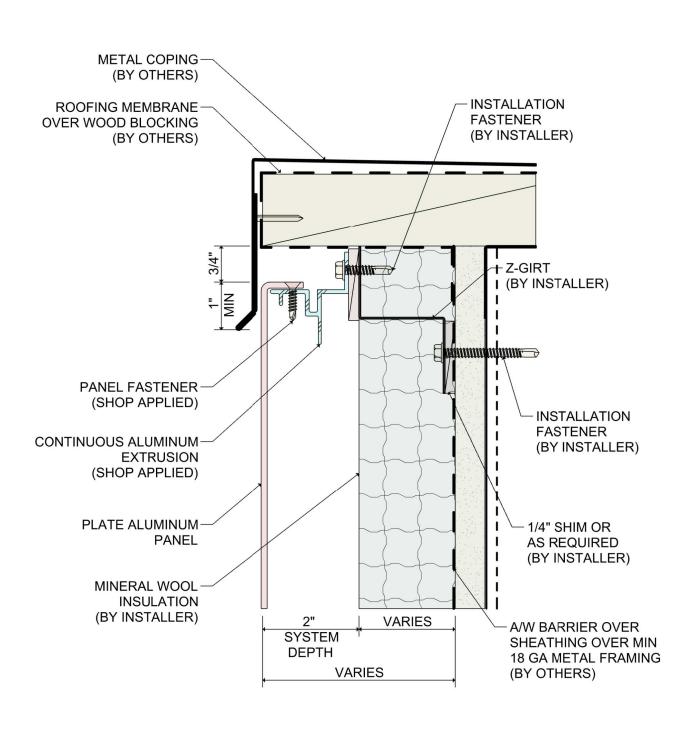


SYSTEM 3550



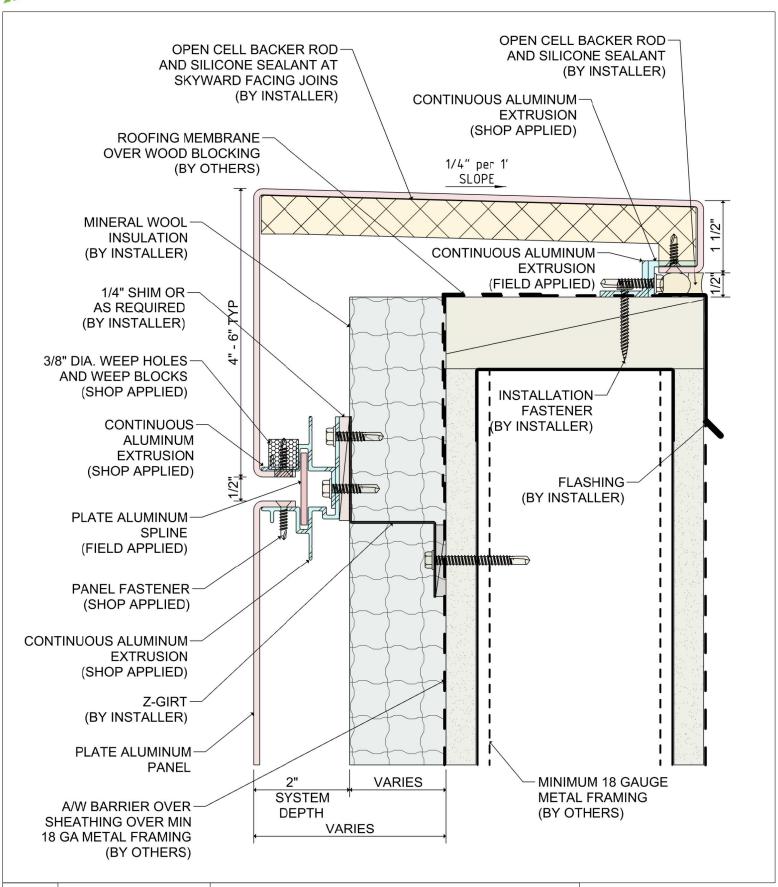


SYSTEM 3550 RAINSCREEN SYSTEM



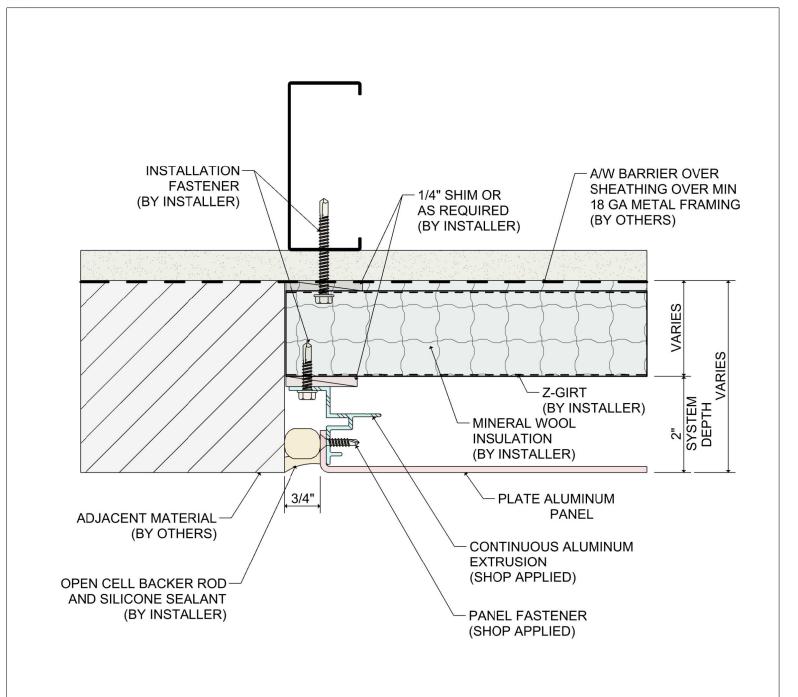

DETAIL:	SYSTEM 3550	RAINSCREEN SYSTEM
9	VERTICAL JAMB DETAIL	




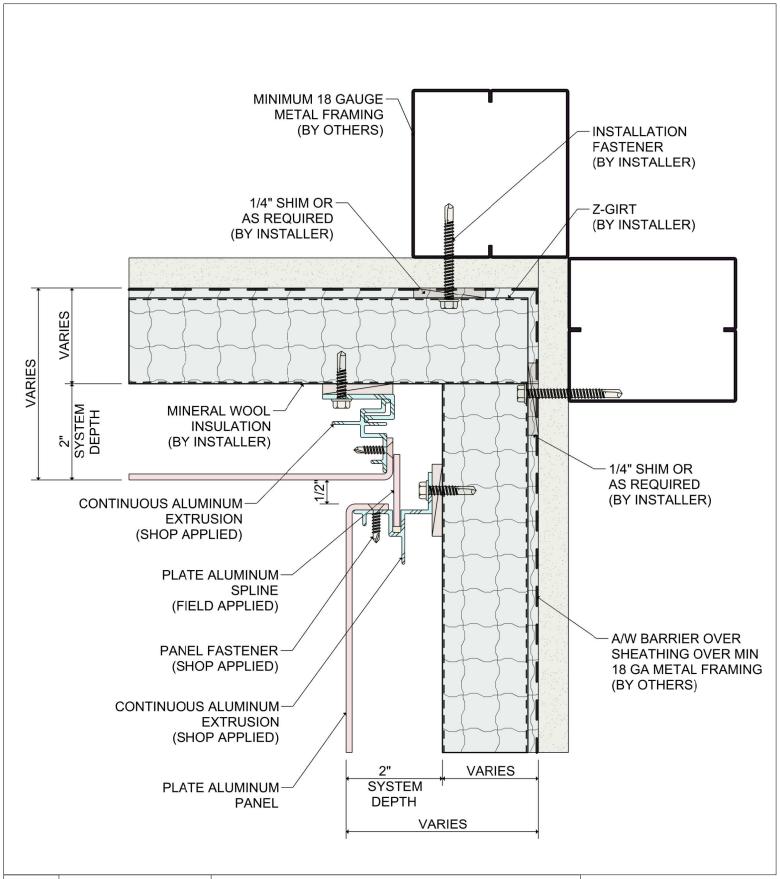

SYSTEM 3550 RAINSCREEN SYSTEM

INSIDE CORNER DETAIL




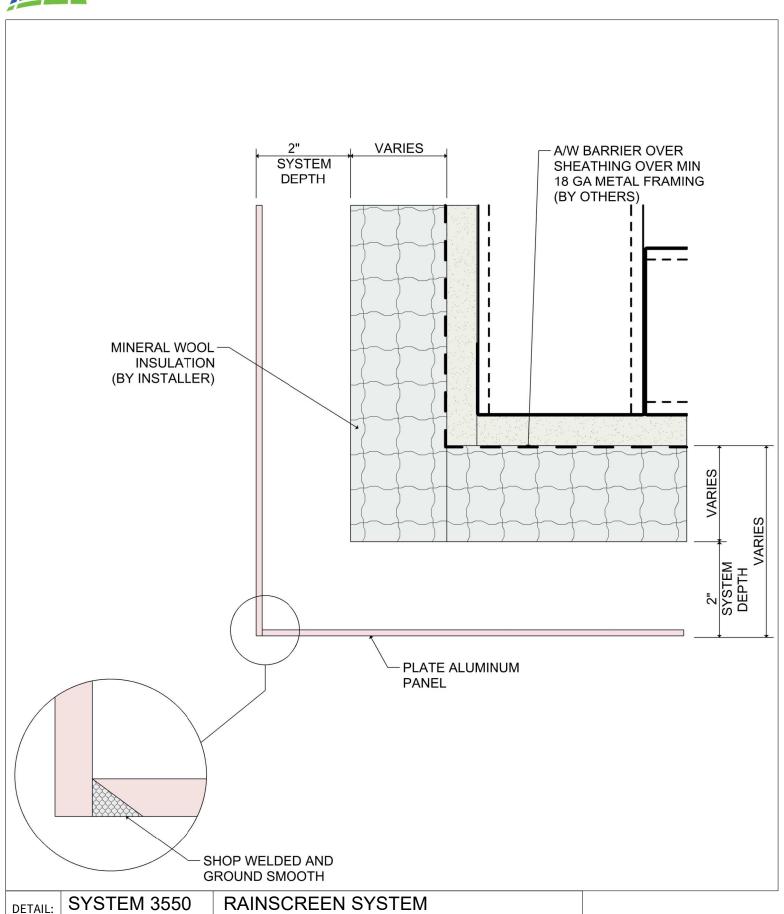

11


HEM JOINT DETAIL



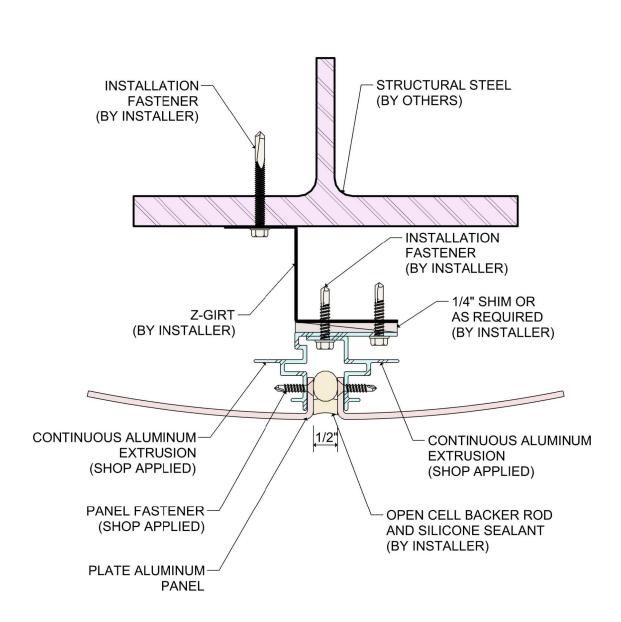


SYSTEM 3550



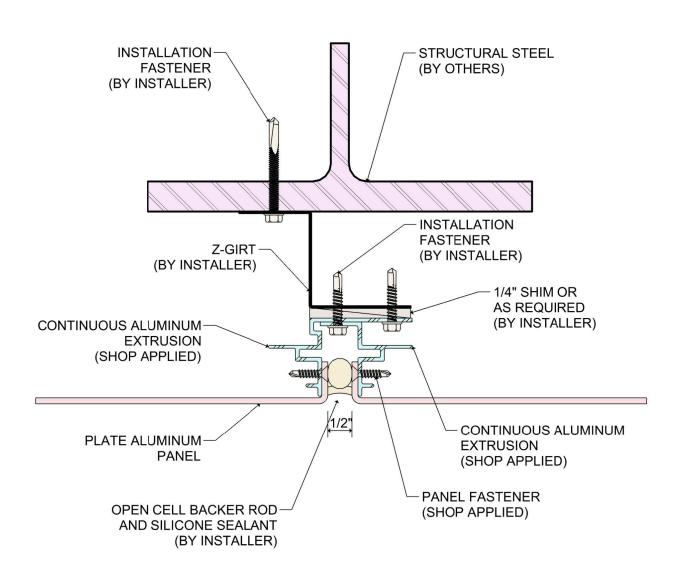


SYSTEM 3550 RAINS



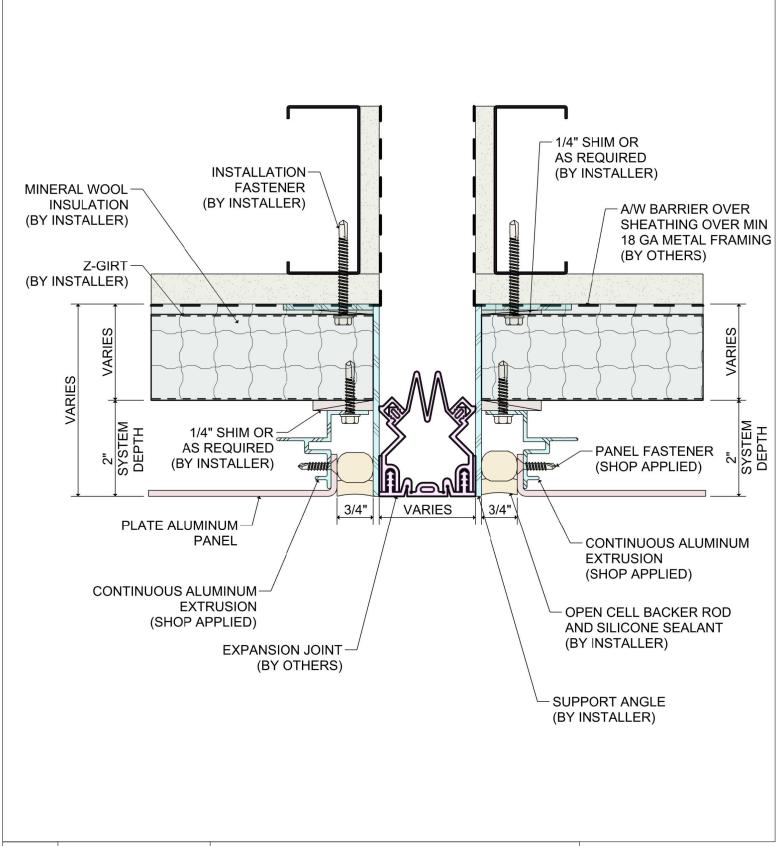


SYSTEM 3550 RAINS



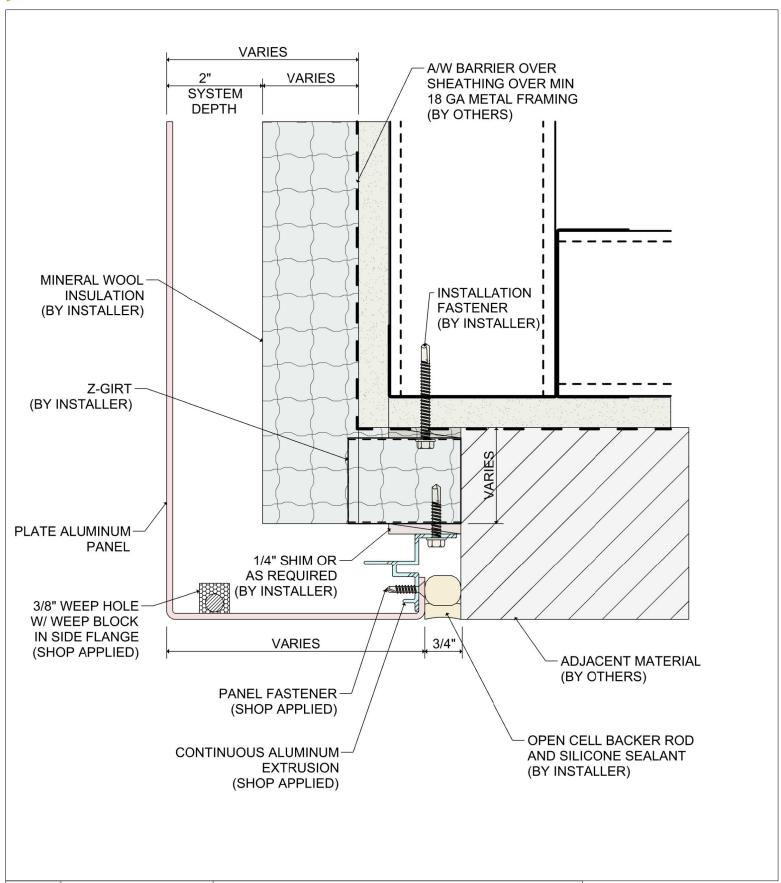


SYSTEM 3550 RAINSCREEN SYSTEM



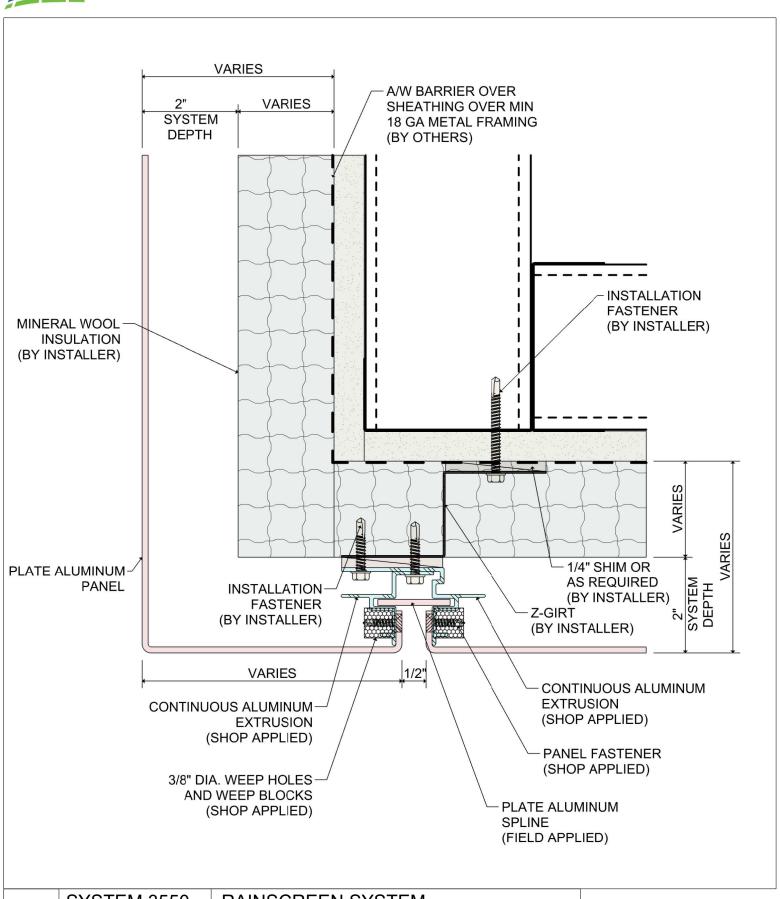


SYSTEM 3550 RAINSCREEN SYSTEM



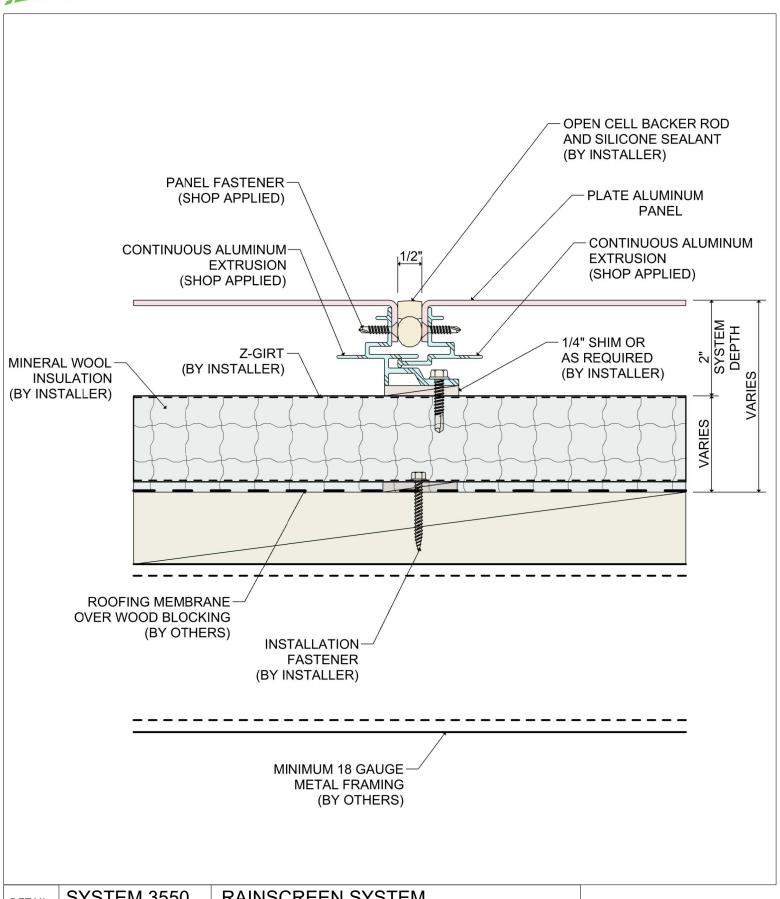

RAINSCREEN SYSTEM SYSTEM 3550




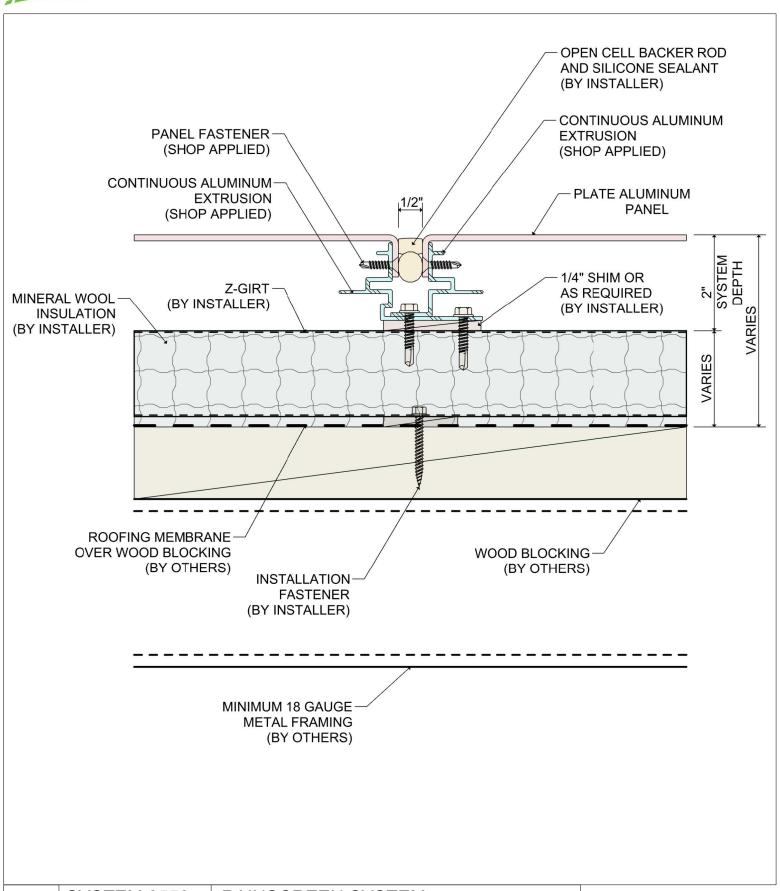

SYSTEM 3550 RAINSCREEN SYSTEM

SKYWARD FACING JOINT- HARD FASTENED



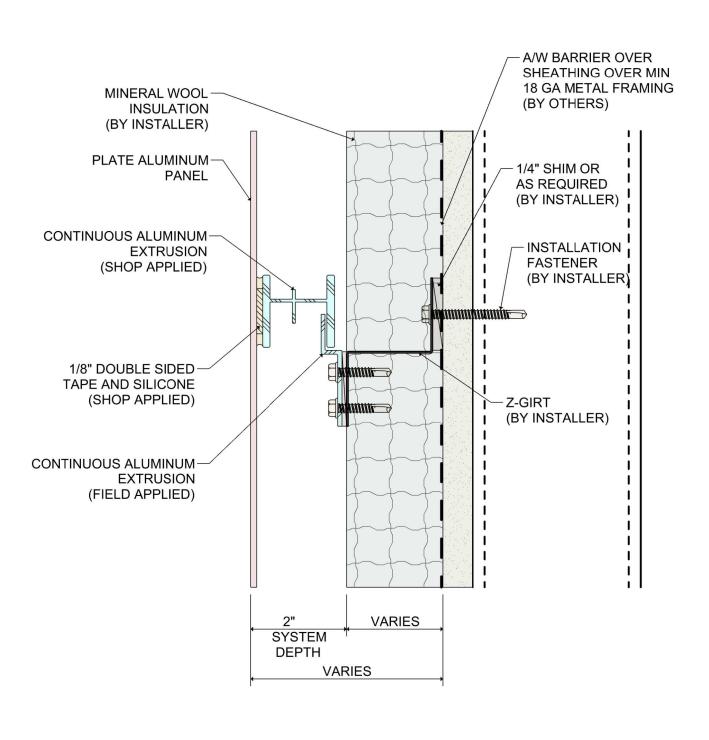

SYSTEM 3550 RAINSCREEN SYSTEM

RETAINER EXTRUSION DETAIL